
WOOD

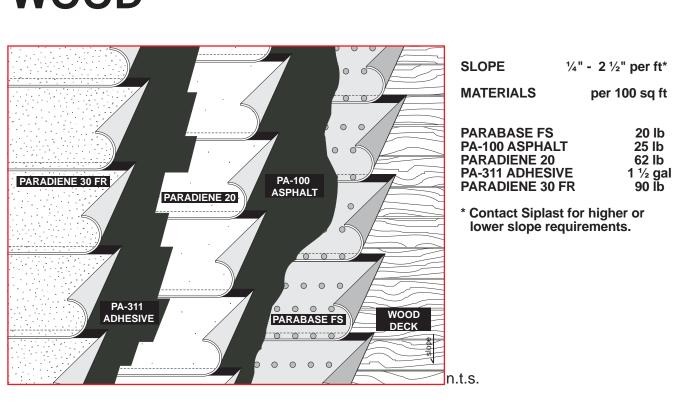

Specification: 2030 WSH-A

Requirements and recommendations detailed in the Siplast catalog and Siplast long form specifications shall apply in addition to the following recommendations and specifications.

Application

- 1. Lay one ply of Parabase FS dry over the entire area to be roofed. Lay each sheet 3 inches over the underlying sheet and lap ends 6 inches. Using approved fasteners, nail each sheet every 9 inches through the laps and stagger nail the remainder of the sheet in two rows on nominal 12 inch centers with fasteners in each row on 12 inch centers. The fastening pattern shown in this specification is based on Siplast standard nailing requirements. Contact Siplast for the recommended fastening patterns to meet specific testing or code approvals.
- 2. Beginning at the low point of the roof, fully mop one ply of Paradiene 20 to the Parabase FS surface using PA-100 Asphalt, lapping sides and ends a minimum of 3 inches. Offset end laps a minimum of 3 feet.
- 3. Beginning again at the low point of the roof, fully adhere one ply of Paradiene 30 FR to the Paradiene 20 surface using PA-311 Adhesive, lapping sides and ends a minimum of 3 inches. Offset end laps a minimum of 3 feet. Stagger laps between plies.

Ref. #: P20-h P30-a Wood-base Date: 11.2.09



